

### SECTION: 1. Product and company identification

#### 1.1. Product identifier

Product form : Substance  
Trade name : Propylene  
CAS-No. : 115-07-1  
Formula : C3H6

#### 1.2. Relevant identified uses of the substance or mixture and uses advised against

Use of the substance/mixture : Industrial use; Use as directed.

#### 1.3. Details of the supplier of the safety data sheet

Praxair, Inc.  
10 Riverview Drive  
Danbury, CT 06810-6268 - USA  
T 1-800-772-9247 (1-800-PRAXAIR) - F 1-716-879-2146  
[www.praxair.com](http://www.praxair.com)

#### 1.4. Emergency telephone number

Emergency number : Onsite Emergency: 1-800-645-4633

CHEMTREC, 24hr/day 7days/week  
— Within USA: 1-800-424-9300, Outside USA: 001-703-527-3887  
(collect calls accepted, Contract 17729)

### SECTION 2: Hazard identification

#### 2.1. Classification of the substance or mixture

##### GHS US classification

Flam. Gas 1    H220  
Press. Gas (Liq.) H280

#### 2.2. Label elements

##### GHS US labeling

Hazard pictograms (GHS US) :



Signal word (GHS US) : Danger

Hazard statements (GHS US) :

H220 - EXTREMELY FLAMMABLE GAS  
H280 - CONTAINS GAS UNDER PRESSURE; MAY EXPLODE IF HEATED  
OSHA-H01 - MAY DISPLACE OXYGEN AND CAUSE RAPID SUFFOCATION.  
CGA-HG04 - MAY FORM EXPLOSIVE MIXTURES WITH AIR  
CGA-HG01 - MAY CAUSE FROSTBITE.

Precautionary statements (GHS US) :

P202 - Do not handle until all safety precautions have been read and understood.  
P210 - Keep away from Heat, Open flames, Sparks, Hot surfaces. - No smoking  
P271+P403 - Use and store only outdoors or in a well-ventilated place.  
P304 - IF INHALED:  
P340 - Remove person to fresh air and keep comfortable for breathing.  
P313 - Get medical advice/attention.  
P302 - IF ON SKIN:  
P336 - Thaw frosted parts with lukewarm water. Do not rub affected area.  
P315 - Get immediate medical advice/attention.  
P377 - LEAKING GAS FIRE: Do not extinguish, unless leak can be stopped safely.  
P381 - Eliminate all ignition sources if safe to do so.  
CGA-PG05 - Use a back flow preventive device in the piping.

CGA-PG12 - Do not open valve until connected to equipment prepared for use.  
CGA-PG06 - Close valve after each use and when empty.  
CGA-PG11 - Never put cylinders into unventilated areas of passenger vehicles.  
CGA-PG02 - Protect from sunlight when ambient temperature exceeds 52°C (125°F).

### 2.3. Other hazards

Other hazards not contributing to the classification : Contact with liquid may cause cold burns/frostbite.

### 2.4. Unknown acute toxicity (GHS US)

No data available

## SECTION 3: Composition/Information on ingredients

### 3.1. Substances

Name	Product identifier	%
Propylene (Main constituent)	(CAS-No.) 115-07-1	100

### 3.2. Mixtures

Not applicable

## SECTION 4: First aid measures

### 4.1. Description of first aid measures

First-aid measures after inhalation : Remove to fresh air and keep at rest in a position comfortable for breathing. If not breathing, give artificial respiration. If breathing is difficult, trained personnel should give oxygen. Call a physician.

First-aid measures after skin contact : The liquid may cause frostbite. For exposure to liquid, immediately warm frostbite area with warm water not to exceed 105°F (41°C). Water temperature should be tolerable to normal skin. Maintain skin warming for at least 15 minutes or until normal coloring and sensation have returned to the affected area. In case of massive exposure, remove clothing while showering with warm water. Seek medical evaluation and treatment as soon as possible. Adverse effects not expected from this product.

First-aid measures after eye contact : Immediately flush eyes thoroughly with water for at least 15 minutes. Hold the eyelids open and away from the eyeballs to ensure that all surfaces are flushed thoroughly. Contact an ophthalmologist immediately.. Get immediate medical attention.

First-aid measures after ingestion : Ingestion is not considered a potential route of exposure.

### 4.2. Most important symptoms and effects, both acute and delayed

No additional information available

### 4.3. Indication of any immediate medical attention and special treatment needed

None.

## SECTION 5: Firefighting measures

### 5.1. Extinguishing media

Suitable extinguishing media : Carbon dioxide, Dry chemical, Water spray or fog.

### 5.2. Special hazards arising from the substance or mixture

Fire hazard : EXTREMELY FLAMMABLE GAS. If venting or leaking gas catches fire, do not extinguish flames. Flammable vapors may spread from leak, creating an explosive reignition hazard. Vapors can be ignited by pilot lights, other flames, smoking, sparks, heaters, electrical equipment, static discharge, or other ignition sources at locations distant from product handling point. Explosive atmospheres may linger. Before entering an area, especially a confined area, check the atmosphere with an appropriate device.

Explosion hazard : EXTREMELY FLAMMABLE GAS. Forms explosive mixtures with air and oxidizing agents.

Reactivity : No reactivity hazard other than the effects described in sub-sections below.

### 5.3. Advice for firefighters

- Firefighting instructions : Evacuate all personnel from the danger area. Use self-contained breathing apparatus (SCBA) and protective clothing. Immediately cool containers with water from maximum distance. Stop flow of gas if safe to do so, while continuing cooling water spray. Remove ignition sources if safe to do so. Remove containers from area of fire if safe to do so. On-site fire brigades must comply with OSHA 29 CFR 1910.156 and applicable standards under 29 CFR 1910 Subpart L—Fire Protection.
- Protection during firefighting : Compressed gas: asphyxiant. Suffocation hazard by lack of oxygen.
- Special protective equipment for fire fighters : Standard protective clothing and equipment (Self Contained Breathing Apparatus) for fire fighters.
- Specific methods : Use fire control measures appropriate for the surrounding fire. Exposure to fire and heat radiation may cause gas containers to rupture. Cool endangered containers with water spray jet from a protected position. Prevent water used in emergency cases from entering sewers and drainage systems.
- Stop flow of product if safe to do so.
- Use water spray or fog to knock down fire fumes if possible.
- Do not extinguish a leaking gas flame unless absolutely necessary. Spontaneous/explosive re-ignition may occur. Extinguish any other fire.

## SECTION 6: Accidental release measures

### 6.1. Personal precautions, protective equipment and emergency procedures

- General measures : Eliminate ignition sources. Evacuate area. Prevent from entering sewers, basements and workpits, or any place where its accumulation can be dangerous. Wear self-contained breathing apparatus when entering area unless atmosphere is proven to be safe. Ensure adequate ventilation. Stop leak if safe to do so.

#### 6.1.1. For non-emergency personnel

No additional information available

#### 6.1.2. For emergency responders

No additional information available

### 6.2. Environmental precautions

Try to stop release. Prevent waste from contaminating the surrounding environment. Prevent soil and water pollution. Dispose of contents/container in accordance with local/regional/national/international regulations. Contact supplier for any special requirements.

### 6.3. Methods and material for containment and cleaning up

No additional information available

### 6.4. Reference to other sections

See also sections 8 and 13.

## SECTION 7: Handling and storage

### 7.1. Precautions for safe handling

- Precautions for safe handling : Keep away from heat, hot surfaces, sparks, open flames and other ignition sources. No smoking. Use only non-sparking tools. Use only explosion-proof equipment.
- Wear leather safety gloves and safety shoes when handling cylinders. Protect cylinders from physical damage; do not drag, roll, slide or drop. While moving cylinder, always keep in place removable valve cover. Never attempt to lift a cylinder by its cap; the cap is intended solely to protect the valve. When moving cylinders, even for short distances, use a cart (trolley, hand truck, etc.) designed to transport cylinders. Never insert an object (e.g. wrench, screwdriver, pry bar) into cap openings; doing so may damage the valve and cause a leak. Use an adjustable strap wrench to remove over-tight or rusted caps. Slowly open the valve. If the valve is hard to open, discontinue use and contact your supplier. Close the container valve after each use; keep closed even when empty. Never apply flame or localized heat directly to any part of the container. High temperatures may damage the container and could cause the pressure relief device to fail prematurely, venting the container contents. For other precautions in using this product, see section 16.

### 7.2. Conditions for safe storage, including any incompatibilities

Storage conditions : Store only where temperature will not exceed 125°F (52°C). Post “No Smoking/No Open Flames” signs in storage and use areas. There must be no sources of ignition. Separate packages and protect against potential fire and/or explosion damage following appropriate codes and requirements (e.g, NFPA 30, NFPA 55, NFPA 70, and/or NFPA 221 in the U.S.) or according to requirements determined by the Authority Having Jurisdiction (AHJ). Always secure containers upright to keep them from falling or being knocked over. Install valve protection cap, if provided, firmly in place by hand when the container is not in use. Store full and empty containers separately. Use a first-in, first-out inventory system to prevent storing full containers for long periods. For other precautions in using this product, see section 16.

**OTHER PRECAUTIONS FOR HANDLING, STORAGE, AND USE:** When handling product under pressure, use piping and equipment adequately designed to withstand the pressures to be encountered. Never work on a pressurized system. Use a back flow preventive device in the piping. Gases can cause rapid suffocation because of oxygen deficiency; store and use with adequate ventilation. If a leak occurs, close the container valve and blow down the system in a safe and environmentally correct manner in compliance with all international, federal/national, state/provincial, and local laws; then repair the leak. Never place a container where it may become part of an electrical circuit.

### 7.3. Specific end use(s)

None.

## SECTION 8: Exposure controls/personal protection

### 8.1. Control parameters

Propylene (115-07-1)		
ACGIH	ACGIH TLV-TWA (ppm)	500 ppm
USA OSHA	Not established	

### 8.2. Exposure controls

Appropriate engineering controls : During welding, ensure that there is adequate ventilation to keep worker exposure below applicable limits for fumes, gases, and other by-products of welding. Do not breathe fumes or gases. Short-term overexposure to fumes may cause dizziness, nausea, and dryness or irritation of the nose, throat, and eyes, or may cause other similar discomfort. Use an explosion-proof local exhaust system. Local exhaust and general ventilation must be adequate to meet exposure standards. **MECHANICAL (GENERAL): Inadequate - Use only in a closed system.** Use explosion proof equipment and lighting.

Hand protection : Wear working gloves when handling gas containers. Wear work gloves when handling containers; welding gloves for welding. Gloves must be free of oil and grease.

Eye protection : Wear safety glasses with side shields or goggles when transfilling or breaking transfer connections. Wear safety glasses with side shields.

Respiratory protection : When workplace conditions warrant respirator use, follow a respiratory protection program that meets OSHA 29 CFR 1910.134, ANSI Z88.2, or MSHA 30 CFR 72.710 (where applicable). Use an air-supplied or air-purifying cartridge if the action level is exceeded. Ensure that the respirator has the appropriate protection factor for the exposure level. If cartridge type respirators are used, the cartridge must be appropriate for the chemical exposure. For emergencies or instances with unknown exposure levels, use a self-contained breathing apparatus (SCBA).

Thermal hazard protection : Wear cold insulating gloves when transfilling or breaking transfer connections.

Environmental exposure controls : Refer to local regulations for restriction of emissions to the atmosphere. See section 13 for specific methods for waste gas treatment.

Other information : Wear safety shoes while handling containers. Consider the use of flame resistant anti-static safety clothing. Wear leather safety gloves and safety shoes when handling cylinders.

## SECTION 9: Physical and chemical properties

### 9.1. Information on basic physical and chemical properties

Physical state : Gas  
 Appearance : Colorless gas.  
 Molecular mass : 42 g/mol  
 Color : Colorless.

Odor	: Stenchant often added. Sweetish.
Odor threshold	: Odor threshold is subjective and inadequate to warn for overexposure.
pH	: Not applicable.
Relative evaporation rate (butyl acetate=1)	: No data available
Relative evaporation rate (ether=1)	: Not applicable.
Melting point	: No data available
Freezing point	: -185.25 °C (-301.45°F)
Boiling point	: -47.7 °C (-53.9°F)
Flash point	: -107.8 °C (-162°F)
Critical temperature	: 91.8 °C (197.24°F)
Auto-ignition temperature	: 455 °C (851°F)
Decomposition temperature	: No data available
Flammability (solid, gas)	: 2 - 11.1
Vapor pressure	: 10.2 bar (132.81 psig) @70°F (21.1 °C), 1 ATM
Relative vapor density at 20 °C	: No data available
Relative density	: 0.6
Density	: 0.5139 g/cm <sup>3</sup> (at 20 °C)
Relative gas density	: 1.5
Solubility	: Water: 384 mg/l
Log Pow	: 1.77
Log Kow	: Not applicable.
Viscosity, kinematic	: Not applicable.
Viscosity, dynamic	: Not applicable.
Explosive properties	: Not applicable.
Oxidizing properties	: None.
Explosion limits	: No data available

### 9.2. Other information

Gas group	: Press. Gas (Liq.)
Additional information	: Gas/vapor heavier than air. May accumulate in confined spaces, particularly at or below ground level.

## SECTION 10: Stability and reactivity

### 10.1. Reactivity

No reactivity hazard other than the effects described in sub-sections below.

### 10.2. Chemical stability

Stable under normal conditions.

### 10.3. Possibility of hazardous reactions

Can form explosive mixture with air. May react violently with oxidants.

### 10.4. Conditions to avoid

Keep away from heat/sparks/open flames/hot surfaces. – No smoking.

### 10.5. Incompatible materials

Oxidizing agent. Acids. Halogens.

### 10.6. Hazardous decomposition products

Thermal decomposition or burning may produce carbon monoxide, carbon dioxide, and hydrogen. The welding and cutting process may form reaction products such as carbon monoxide and carbon dioxide. Other decomposition products of normal operation originate from the volatilization, reaction, or oxidation of the material being worked.

### SECTION 11: Toxicological information

#### 11.1. Information on toxicological effects

Acute toxicity : Not classified

Propylene ( 1f )115-07-1	
LC50 inhalation rat (ppm)	> 65000 ppm/4h
ATE US (vapors)	658 mg/l/4h
ATE US (dust, mist)	658 mg/l/4h

Skin corrosion/irritation : Not classified  
pH: Not applicable.

Serious eye damage/irritation : Not classified  
pH: Not applicable.

Respiratory or skin sensitization : Not classified

Germ cell mutagenicity : Not classified

Carcinogenicity : Not classified

Propylene (115-07-1)	
IARC group	3 - Not classifiable

Reproductive toxicity : Not classified

Specific target organ toxicity – single exposure : Not classified

Specific target organ toxicity – repeated exposure : Not classified

Aspiration hazard : Not classified

### SECTION 12: Ecological information

#### 12.1. Toxicity

Ecology - general : No ecological damage caused by this product.

#### 12.2. Persistence and degradability

Propylene (115-07-1)	
Persistence and degradability	The substance is biodegradable. Unlikely to persist.

#### 12.3. Bioaccumulative potential

Propylene (115-07-1)	
Log Pow	1.77
Log Kow	Not applicable.
Bioaccumulative potential	Not expected to bioaccumulate due to the low log Kow (log Kow < 4). Refer to section 9.

#### 12.4. Mobility in soil

Propylene (115-07-1)	
Mobility in soil	No data available.
Ecology - soil	Because of its high volatility, the product is unlikely to cause ground or water pollution.

#### 12.5. Other adverse effects

Effect on ozone layer : None.

Effect on the global warming : No known effects from this product.

### SECTION 13: Disposal considerations

#### 13.1. Waste treatment methods

Product/Packaging disposal recommendations : Dispose of contents/container in accordance with local/regional/national/international regulations. Contact supplier for any special requirements.

# Propylene

## Safety Data Sheet P-4648

This SDS conforms to U.S. Code of Federal Regulations 29 CFR 1910.1200, Hazard Communication.  
 Date of issue: 01/01/1983    Revision date: 01/17/2019    Supersedes: 10/24/2016

### SECTION 14: Transport information

In accordance with DOT

Transport document description : UN1077 Propylene, 2.1  
 UN-No.(DOT) : UN1077  
 Proper Shipping Name (DOT) : Propylene  
 Class (DOT) : 2.1 - Class 2.1 - Flammable gas 49 CFR 173.115  
 Hazard labels (DOT) : 2.1 - Flammable gas



DOT Special Provisions (49 CFR 172.102) : 19 - For domestic transportation only, the identification number UN1075 may be used in place of the identification number specified in column (4) of the 172.101 table. The identification number used must be consistent on package markings, shipping papers and emergency response information.  
 T50 - When portable tank instruction T50 is referenced in Column (7) of the 172.101 Table, the applicable liquefied compressed gases are authorized to be transported in portable tanks in accordance with the requirements of 173.313 of this subchapter.

#### Additional information

Emergency Response Guide (ERG) Number : 115 (UN1075)  
 Other information : No supplementary information available.  
 Special transport precautions : Avoid transport on vehicles where the load space is not separated from the driver's compartment. Ensure vehicle driver is aware of the potential hazards of the load and knows what to do in the event of an accident or an emergency. Before transporting product containers:  
 - Ensure there is adequate ventilation. - Ensure that containers are firmly secured. - Ensure cylinder valve is closed and not leaking. - Ensure valve outlet cap nut or plug (where provided) is correctly fitted. - Ensure valve protection device (where provided) is correctly fitted.

#### Transport by sea

UN-No. (IMDG) : 1077  
 Proper Shipping Name (IMDG) : PROPYLENE  
 Class (IMDG) : 2 - Gases  
 Division (IMDG) : 2.1 - Flammable gases  
 MFAG-No : 115

#### Air transport

UN-No. (IATA) : 1077  
 Proper Shipping Name (IATA) : Propylene  
 Class (IATA) : 2  
 Civil Aeronautics Law : Gases under pressure/Gases flammable under pressure

### SECTION 15: Regulatory information

#### 15.1. US Federal regulations

Propylene (115-07-1)	
Listed on the United States TSCA (Toxic Substances Control Act) inventory	
Subject to reporting requirements of United States SARA Section 313	
SARA Section 311/312 Hazard Classes	Immediate (acute) health hazard Fire hazard Sudden release of pressure hazard Delayed (chronic) health hazard
SARA Section 313 - Emission Reporting	1 %



# Propylene

## Safety Data Sheet P-4648

This SDS conforms to U.S. Code of Federal Regulations 29 CFR 1910.1200, Hazard Communication.  
Date of issue: 01/01/1983    Revision date: 01/17/2019    Supersedes: 10/24/2016

### Propylene (115-07-1)

All components of this product are listed on the Toxic Substances Control Act (TSCA) inventory.

Chemical(s) subject to the reporting requirements of Section 313 or Title III of the Superfund Amendments and Reauthorization Act (SARA) of 1986 and 40 CFR Part 372.

Propylene	CAS-No. 115-07-1	100%
-----------	------------------	------

### 15.2. International regulations

#### CANADA

### Propylene (115-07-1)

Listed on the Canadian DSL (Domestic Substances List)

#### EU-Regulations

### Propylene (115-07-1)

Listed on the EEC inventory EINECS (European Inventory of Existing Commercial Chemical Substances)

### 15.2.2. National regulations

### Propylene (115-07-1)

Listed on the AICS (Australian Inventory of Chemical Substances)  
Listed on IECSC (Inventory of Existing Chemical Substances Produced or Imported in China)  
Listed on the Japanese ENCS (Existing & New Chemical Substances) inventory  
Listed on the Japanese ISHL (Industrial Safety and Health Law)  
Listed on the Korean ECL (Existing Chemicals List)  
Listed on NZIoC (New Zealand Inventory of Chemicals)  
Listed on PICCS (Philippines Inventory of Chemicals and Chemical Substances)  
Listed on INSQ (Mexican National Inventory of Chemical Substances)  
Listed on the TCSI (Taiwan Chemical Substance Inventory)

### 15.3. US State regulations

### Propylene(115-07-1)

U.S. - California - Proposition 65 - Carcinogens List	No
U.S. - California - Proposition 65 - Developmental Toxicity	No
U.S. - California - Proposition 65 - Reproductive Toxicity - Female	No
U.S. - California - Proposition 65 - Reproductive Toxicity - Male	No
State or local regulations	U.S. - Massachusetts - Right To Know List U.S. - New Jersey - Right to Know Hazardous Substance List U.S. - Pennsylvania - RTK (Right to Know) - Environmental Hazard List U.S. - Pennsylvania - RTK (Right to Know) List

California Proposition 65 - This product does not contain any substances known to the state of California to cause cancer, developmental and/or reproductive harm



# Propylene

## Safety Data Sheet P-4648

This SDS conforms to U.S. Code of Federal Regulations 29 CFR 1910.1200, Hazard Communication.  
 Date of issue: 01/01/1983    Revision date: 01/17/2019    Supersedes: 10/24/2016

### SECTION 16: Other information

**Other information**

: When using this product in welding and cutting, read and understand the manufacturer's instructions and the precautionary label on the product. Ask your welding products supplier for a copy of Praxair's free safety booklet, P-2035, Precautions and Safe Practices for Gas Welding, Cutting, and Heating, and for other manufacturers' safety publications. For a detailed treatment, get ANSI Z49.1, Safety in Welding, Cutting, and Allied Processes, published by the American Welding Society (AWS), [www.aws.org](http://www.aws.org). Order AWS documents from Global Engineering Documents, [global.ihc.com](http://global.ihc.com). Arcs and sparks can ignite combustible materials. Prevent fires. Refer to NFPA 51B, Standard for Fire Prevention During Welding, Cutting, and Other Hotwork. Do not strike an arc on the container. The defect produced by an arc burn may lead to container rupture.

Fumes and gases produced during welding and cutting processes can be dangerous to your health and may cause serious lung disease. **KEEP YOUR HEAD OUT OF FUMES. DO NOT BREATHE FUMES AND GASES.** Use enough ventilation, local exhaust, or both to keep fumes and gases from your breathing zone and the general area. Short-term overexposure to fumes may cause dizziness, nausea, and dryness or irritation of the nose, throat, and eyes; or may cause other similar discomfort. Contaminants in the air may add to the hazard of fumes and gases.

When you mix two or more chemicals, you can create additional, unexpected hazards. Obtain and evaluate the safety information for each component before you produce the mixture. Consult an industrial hygienist or other trained person when you evaluate the end product. Before using any plastics, confirm their compatibility with this product.

Praxair asks users of this product to study this SDS and become aware of the product hazards and safety information. To promote safe use of this product, a user should (1) notify employees, agents, and contractors of the information in this SDS and of any other known product hazards and safety information, (2) furnish this information to each purchaser of the product, and (3) ask each purchaser to notify its employees and customers of the product hazards and safety information.

The opinions expressed herein are those of qualified experts within Praxair, Inc. We believe that the information contained herein is current as of the date of this Safety Data Sheet. Since the use of this information and the conditions of use are not within the control of Praxair, Inc, it is the user's obligation to determine the conditions of safe use of the product.

Praxair SDSs are furnished on sale or delivery by Praxair or the independent distributors and suppliers who package and sell our products. To obtain current SDSs for these products, contact your Praxair sales representative, local distributor, or supplier, or download from [www.praxair.com](http://www.praxair.com). If you have questions regarding Praxair SDSs, would like the document number and date of the latest SDS, or would like the names of the Praxair suppliers in your area, phone or write the Praxair Call Center (Phone: 1-800-PRAXAIR/1-800-772-9247; Address: Praxair Call Center, Praxair, Inc, P.O. Box 44, Tonawanda, NY 14151-0044).

PRAXAIR and the Flowing Airstream design are trademarks or registered trademarks of Praxair Technology, Inc. in the United States and/or other countries.

**Revision date**

: 01/17/2019

**NFPA health hazard**


: 2 - Materials that, under emergency conditions, can cause temporary incapacitation or residual injury.

**NFPA fire hazard**

: 4 - Materials that rapidly or completely vaporize at atmospheric pressure and normal ambient temperature or that are readily dispersed in air and burn readily.

**NFPA reactivity**

: 1 - Materials that in themselves are normally stable but can become unstable at elevated temperatures and pressures.

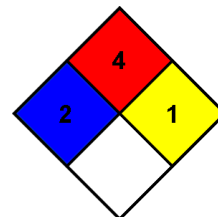



# Propylene

## Safety Data Sheet P-4648

This SDS conforms to U.S. Code of Federal Regulations 29 CFR 1910.1200, Hazard Communication.

Date of issue: 01/01/1983    Revision date: 01/17/2019    Supersedes: 10/24/2016

---

### Hazard Rating

Health : 1 Slight Hazard - Irritation or minor reversible injury possible  
Flammability : 4 Severe Hazard  
Physical : 2 Moderate Hazard

SDS US (GHS HazCom 2012) - Praxair

*This information is based on our current knowledge and is intended to describe the product for the purposes of health, safety and environmental requirements only. It should not therefore be construed as guaranteeing any specific property of the product.*